

Educational Suitability Summary Report

Akins Early College High School

Date: 01/25/2021 Score 59% Average

Akins Early College High School serves an enrollment of approximately 2,800 students in far south Austin. The school's purpose statement is to graduate all students prepared to be successful in any postsecondary endeavor. The original campus was built in 2000, and stand-alone studio and science additions were added in 2008 and 2010. Akins is an academy school featuring seven academies that each have 400-500 students. The layout of the teaching spaces in studios is based around these academies.

In addition to the buildings, the school has 24 portables for approximately 40 studios. While this assessment does not evaluate the portables, it is assumed that the programs taught out of these portables do not meet current Ed Spec standards. The list of programs currently taught in portables is sign language, French, Spanish, drama, veterinary clinic, and the health science program. Spanish I classes can have at least 40 students and holding these large classes in a portable studio is problematic.

The athletic fields and track are on the other side of Old San Antonio Road. Traffic has increased exponentially on this road and creates safety concerns for students trying to cross. While it is in a school zone, cars are often driving far over the speed limit, and this was observed during the assessment walk.

Interview Overview

The administrators who attended the interview were Principal Salazar, Associate Principal Garcia and Management Assistant Senaida Martinez. The campus is a series of buildings creating a large central courtyard. The portables are located toward the back of the campus along Old San Antonio Road. The group indicated several programs are in portables, including the vet clinic and health science programs. The multilanguage studios are also in portables. The group indicated that the career and tech classes, greenhouse and barn are not in suitable spaces.

The location of the track and soccer field across Old San Antonio Road is a concern. The group indicated there have been several pedestrian accidents. There are no protective lights for students to cross the street. There are inadequacies in the support buildings for the soccer field and track area. The baseball program has limited space and currently changes in regular restrooms. There is not enough space for PE.

One of the academies is in the fine arts building. There is not adequate space for the piano program. The most needed spaces in fine arts according to the group are a larger dance studio, art rooms and drama studios. Only one of the drama teachers is in the fine arts building. The other two teach out of a portable.

Educational Suitability Summary Report

Akins Early College High School

Their wish list programs/spaces include welding, dentistry, fire academy, maker space, digital media (green screen room), recording studio and filmmaking lab. The fire academy is scheduled to become a program but will not have suitable space to use. The school has a recording studio, but it is makeshift and is championed by the teacher without additional district support.



The group indicated the priority for them is to remove classes from the portables and said there is a need for large collaboration spaces for staff, students and the public.

Assessment Findings

The Educational Suitability Assessment of Akins Early College High School earned a 59% overall score and places the campus in a category of Average. The assessment consists of seven General Building categories and eight Academic categories to determine areas that need more attention.

Unsatisfactory Categories (36-50%):

Security

Score is unsatisfactory.

Controllability of Systems

Score is unsatisfactory.

There is only a single switch on/off for lights. All studios have mini blinds that are in average shape. Not all studios have a thermostat.

Academic & Learning

Score is unsatisfactory.

Studios are slightly undersized at 790 SF. Science labs are adequately sized. The school does not have any Profession Learning Centers for instructors, and there is no group, small group or individual study space throughout the studio wings. A few of the CTE programs are in portables.

Food Services

Score is unsatisfactory.

The cafeteria and kitchen are undersized for the current student enrollment. There is only one type of seating available.

Educational Suitability Summary Report

Akins Early College High School

Average Categories (51-65%):

Outdoor Learning and Activity

Score is average.

The school does not utilize outdoor studios. There are no cisterns, rain gardens or student gardens on campus. There is a grass field and track.

Furniture, Fixtures, Equipment

Score is average.

Furniture is in average condition and ergonomic/sized appropriately for grade level. The library has different types of seating, but many locations do not have furniture that is easily reconfigured.

Visual and Performing Arts

Score is average.

Some programs are not in suitable spaces. Piano is in an old music storage room, which creates acoustic and visual issues. The theater is adequately sized, but a few support spaces are lacking. The dressing rooms are undersized for the size of productions, and the scene shop behind the stage does not have a sink. Paint brushes are being washed in regular sinks. The visual art rooms and dance studio are satisfactory. The dance studio is undersized for the program.

Athletics and Wellness

Score is average.

The gym and auxiliary gym are adequately sized but all portions of athletics are dated. The weight room has been recently upgraded and is in adequate shape. There is no storage for off-campus sports, such as golf, swimming, etc. The track is across the street, and the fields are spread across campus.

Media Resources

Score is average.

The library is at the main entry but does not have a secure after-hours entry. The library is one large open space and may not be conducive to quiet study. The furniture is set up to accommodate different group sizes. There are charging towers, a computer lab and movable digital displays.

Technology

Score is average.

Outlet placement throughout the school is average. There are movable digital displays in all studios along with whiteboards and some projectors. The A/V in the cafeteria/gym is dated. Throughout the school, many studios still have ceiling-mounted bulky televisions that are likely original to the school.

Administration Spaces

Score is average.

The administration space feels welcoming but is far removed from front door. The conference room within the administration space is co-located with the principal's office.

Satisfactory Categories (66-80%):

Educational Suitability Summary Report

Akins Early College High School

Exterior

Score is satisfactory.

There is adequate separation of bus pickup/drop-off and student traffic. The school has approximately 50 buses that come and go each day, and they currently line up from Old San Antonio Road through the campus to South First Street. The signage for staff/visitor/student parking is adequate. All three dumpsters (trash, recycling, compost) are present, and the route is barrier free.

General Building

Score is satisfactory.

The hallways are generous and over 10 feet in width. The school does not have a community room. The cafeteria, gym and auditorium can all be accessed separately after-hours. The general appearance of the school is good. The landscape in the middle of the courtyard could be improved to make it a more utilized space.

Environmental Quality

Score is satisfactory.


All studios have access to natural daylight and views outside. There was a strong musty odor in the third gym while completing the assessment walk. The school has had rat issues, and there are reports of bats in the theater entering through the roof, which is under repair.

CTE and Career Connected Learning

Score is satisfactory.

Akins has the most CTE programs of any school in the district. While the offerings of the CTE program are plentiful, the teaching spaces need some upgrades to function for their intended purposes. Health science, vet tech, ag barn, and greenhouse were all noted as needing upgrades.

Supporting Photographs

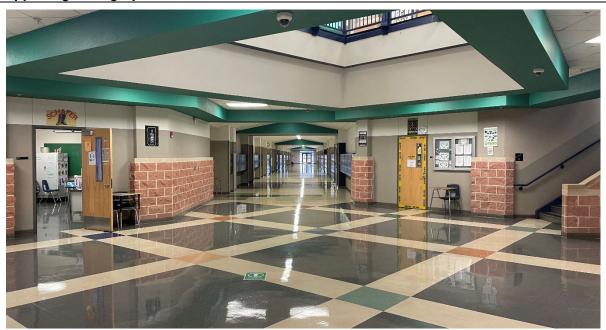

Main corridors and circulations in main studio building. Corridors are wide and have natural daylight.



Fine Arts: Orchestra room is under-sized. Band, orchestra, choir all have limited practice rooms and current practice rooms are being used as storage.



Academics and Learning: Science room are in adequate shape with flexible seating arrangements and sink areas along the edge.



Athletics and Wellness: Large gymnasium space for basketball and volleyball is adequately sized.



Food Service: Cafeteria located in a separate building. It is undersized for the current student enrollment.



Outdoor Learning and Activity: Center courtyard space needs upgrades to landscaping and furniture to function as outdoor studios or collaboration space.



Media Resources: Open-concept library with computer stations.



View of exits to central courtyard space from main building.



Computer lab studio in tech building is adequately sized, but there is no power for center tables.



Athletics: Condition of fields could use improvement. No site lighting is provided at the fields.



Austin ISD Educational Suitability Assessment Criteria

General Building

School Name	Walk Attendees:	Date:
Akins Early College High School	Carlos Cruz / Lynn Petermann	1/25/2021

1 - E:	xterior		1	2	3	4	5	N/A		8.75	77%
1.1	Does the site pedestrian t	e permit desirable separation of vehicular, bus and traffic?				4			Comments	1.00	4.00
	1	Very unsatisfactory - Bus, car and pedestrian all happen at the same location							Yes, buses come off of Old San Antonio Road.		
	2	Unsatisfactory - Cars and buses mix, pedestrians are separated									
	3	Average - Buses, cars, and pedestrians are separate but stack space is small									
	4	Satisfactory - Buses, cars, and pedestrians are separate but drop off does not have a canopy or a holding place like a commons or cafeteria									
	5	Very satisfactory - Buses, cars, and pedestrians are separate and drop off area has a canopy and destination									
	N/A	Does not apply									
1.2		ng easily identified with appropriate signage and wayfinding?			3				Comments	0.25	0.75
	1	Very unsatisfactory - Campus has no signage / wayfinding							Signage is average.		
	2	Unsatisfactory - Signage/wayfinding is faded/hidden									
	3	Average - Signage / wayfinding visible but not apparent									
	4	Satisfactory - Signage / wayfinding is visible but not good condition									
	5	Very satisfactory - Signage and wayfinding is visible and easy to use									

1 - E	xterior (con	t.)	1	2	3	4	5	N/A			
1.3	Is the dumps	ster accessible for trash / compost disposal?				4			Comments	0.50	2.00
	1	Very unsatisfactory - No compost present, route has obstacles (stairs, curbs, barriers) to dumpster		•		•	•	•	All present and no obstacles.		
	2	Unsatisfactory - Compost is present. Route has obstacles to dumpster									
	3	Average - Compost is present (<100' to cafeteria), Route to dumpster is free and clear but the two are not directly adjacent.									
	4	Satisfactory - Compost and dumpster are directly adjacent and route is barrier free									
	5	Very Satisfactory - Compost and dumpster are directly adjacent and route is barrier free. Dumpster are shaped / positioned so people of all heights can access it.									
	N/A	Does not apply									
2 - 0	Outdoor Lea	rning and Activity	1	2	3	4	5	N/A	. 1	10.00	60%
2.1	Are outdoor the ed spec?	studios and support spaces appropriately configured per	1						Comments	1.00	1.00
	1	Very unsatisfactory - No dedicated outdoor studios							No currently outdoor studios. Courtyard space has tables, bu	ıt requires	
	2	Unsatisfactory - Too small, poor condition, disconnected from learning spaces, no flexibility, no shade provided							upgrades to function as an outdoor studio.		
	3	Average - Adequate size, adequate condition, needs some renovations or updates to function well, 50% or less shade coverage over studio area									
	4	Satisfactory - Good size, good condition, connected to learning spaces, good flexibility, more than 50% shade coverage over studio area									
	5	Very satisfactory - Generous size, excellent condition, connected to learning spaces, excellent flexibility, full shade coverage over studio area									
	N/A	Does not apply									
2.2		laygrounds (elementary only) and support spaces per the ed spec?						N/A	Comments	0.00	0.00
	1	Very unsatisfactory - No dedicated active playground									
	2	Unsatisfactory - Too small, poor condition, no shade provided									
	3	Average - Adequate size, adequate condition, needs some renovations or updates to function well, 50% or less shade coverage over play structure									
	4	Satisfactory - Good size, good condition, more than 50% shade coverage over play structure									
	5	Very satisfactory - Generous size, excellent condition, full shade coverage over play structure									
	N/A	Does not apply									

02/11/2022 3

2 - 0	utdoor Lec	rning and Activity (cont)	1	2	3	4	5	N/A			
2.3		and support spaces appropriately configured per the ed lation on infrastructure not condition of plants)	1						Comments	0.00	0.00
	1 2	Very unsatisfactory - No dedicated gardens Unsatisfactory - Too small, poor condition, disconnected from learning spaces, no flexibility, no accessible water source							Monitoring answer, does not affect score for Outdoor l	earning and A	ctivity.
	3	Average - Adequate size, adequate condition, needs some renovations or updates to function well, water source is difficult to access									
	4	Satisfactory - Good size, good condition, connected to learning spaces, good flexibility, water source is accessible with 100 ft hose									
	5	Very Satisfactory - Generous size, excellent condition, connected to learning spaces, excellent flexibility, water source is less than 50ft from the garden or has irrigation									
	N/A	Does not apply									
2.4	Are the rain ed spec?	gardens and/or cisterns appropriately configured per the	1						Comments	0.00	0.00
	1	Very unsatisfactory - No rain gardens or cisterns							Monitoring answer, does not affect score for Outdoor L	earning and A	ctivity.
	2	Unsatisfactory - Too small, poor condition, not functioning, disconnected								-	-
	3	Average - Adequate size, adequate condition, is connected, needs some renovations or updates to function well									
	4	Satisfactory - Good size, good condition, functions properly									
	5	Very Satisfactory - Generous size, excellent condition, exceptional functionality, connected to learning spaces, educational signage provided									
	N/A	Does not apply									
2.5	Does the sch	nool have animal husbandry? (optional)					5		Comments	0.00	0.00
	1	No									
	5	Yes									
2.6	Does the sch	nool have nature loop trails? (optional)	1						Comments	0.00	0.00
	1	No Van									
27	5 Does the sch	Yes nool have a learning pond? (optional)	1						Comments	0.00	0.00
2.7	1	No	'						Comments	0.00	0.00
	5	Yes									
2.8	Does the sch	nool have a grass play field and walking trail?					5		Comments	1.00	5.00
	1	No					•				
	5	Yes									

	3 - General Bui	lding	1	2	3	4	5	N/A	4	11.25	69%
	.5 1	circulation routes wide enough to safely and effectively ate student movement?					5		Comments	0.50	2.50
	1	Very unsatisfactory - Primary circulation is 5'-0" to 6'-0"				_	•		Wide generous hallways.		
	2	wide Unsatisfactory - Primary circulation is 6'-0" to 7'-0" wide									
	3	Average - Primary circulation is 7'-0" to 8'-0" wide									
		-									
	4 5	Satisfactory - Primary circulation is 8'-0"-10'-0" wide									
		Very satisfactory - Primary circulation is 10'-0"+ wide									
_	N/A	Does not apply		Г		T	r	1			
	functions w	nity use areas arranged so that the school can allow night ithout full school access?					5		Comments	0.75	3.75
	1	Very unsatisfactory - Cafeteria, gym, and library cannot be accessed after hours							Cafeteria, gym library, and auditorium can all be secur separately after-hours. Library has entry door next to t		
	2	Unsatisfactory - Only one of the public spaces (Cafeteria, Gym and Library) can be accessed from parking and secured after hours							separately ditter-flours. Library flus entity door flext to t	ne credit officir	entry.
	3	Average - Only two of the public spaces can be accessed from parking and secured after hours									
	4	Satisfactory - All of the public spaces can be accessed from parking and secured from the rest of the building but not individually									
	5	Very satisfactory - Cafeteria, gym, and library can be accessed from parking and locked off from rest of campus for night/evening use with their own entrance									
	N/A	Does not apply									
	3.3 Is there a co	ommunity room that is a dedicated meeting space outside of tion?	1						Comments	0.75	0.75
	1	Very unsatisfactory - No dedicated community room								•	
	2	Unsatisfactory - Community room but within school function, no access after school hours									
	3	Average - Community room, moderate size, but need some renovations or updates to function well									
	4	Satisfactory - Community room, good size /layout, meets needs /functions well									
	5	Very Satisfactory - Community room, generous size, nice condition, functions appropriately outside of school function									
	N/A	Does not apply									
		eneral appearance of the school convey pride for the additional decommunity?			3				Comments	0.25	0.75
	1	Very unsatisfactory - General appearance is poor				•	•		Appearance is adequate but landscape needs improve	ements.	
	2	Unsatisfactory - General appearance is aged but ok									
	3	Average - General appearance is good									
	4	Satisfactory - General appearance shows pride in campus and student works									
	5	Very satisfactory - General appearance shows pride in campus and student works and is welcoming to the community									
	N/A	Does not apply									

4	- Security		1	2	3	4	5	N/A		16.25	
	4.1 Does the fo	acility have key card access at all major entries?							Comments	0.25	
	1	Very unsatisfactory - No entries									
	2 3	Unsatisfactory - 1/4 of major entries Average - 1/2 of major entries									
	4	Satisfactory - 3/4 of major entries									
	5	Very satisfactory - All of major entries									
	N/A	Does not apply									
	4.2 How adequ	uate is site lighting and security for the campus overall?							Comments	1.00	
Γ	1	Very unsatisfactory - No exterior lighting, no secure perimeter									
	2	Unsatisfactory - Lighting is limited to front entry only, parking lot lighting poor, security is minimal									
	3	Average - Lighting at all night-use entries and parking lot, but poor condition. Security is moderate									
	4	Satisfactory - Lighting at all night-use entries and parking lots, good condition, signage less visible, perimeter is well secured but needs updates									
	5	Very satisfactory - Signage, parking lots, and entries are well lit, visible and easy to use, perimeter is very secure									
	N/A	Does not apply									
		office located at the school entry and configured with a							Comments		
L	secure vest	ibule to the main corridor? Very unsatisfactory - No secure vestibule, office located far								1.00	
	'	from main entry, allows visitors access to school unsupervised									
	2	Unsatisfactory - No secure vestibule, office located somewhat far from main entry, minimal supervision of visitors									
	3	Average - Office close to entry, views of front door, but no secure vestibule									
	4	Satisfactory - Office is well-located with a secure vestibule, but needs updates									
	5	Very satisfactory - Office well-located with secure vestibule and all appropriate security features									
L	N/A	Does not apply									
L		ough interior transparency for faculty to passively supervise ad their activities who are not in studios?		2					Comments	1.00	2.00
	1	Very unsatisfactory - No transparency of walls									
	2	Unsatisfactory - Limited transparency in certain locations									
	2	Average - Good transparency in certain locations but									
	3	inadequate or missing in other locations of school									
		Satisfactory - Adequate transparency throughout the									
	4	school									
	5	Very satisfactory - Excellent transparency throughout the school									
	N/A	Does not apply									

5 - Environmental Quality	1	2	3	4	5	N/A	1	25.00	76%
5.1 How are acoustics in studios in general?				4			Comments	1.00	4.00
1 Very unsatisfactory - Recognized word/sound from adjacent studio/corridor 2 Unsatisfactory - Audible sound from adjacent studio/corridor 3 Average - Slight sound from outside room 4 Satisfactory - Walls to deck insulated only white noise from mechanical system 5 Very satisfactory - Able to hear quiet speaking from across the room N/A Does not apply 5.2 Is the studio artificial lighting adequate quality?			3				Comments	1.00	
1 Very unsatisfactory - Sporadic lights work, glare, less than 20 FC 2 Unsatisfactory - 10-19 FC or serious glare 3 Average- 20-29 FC minor glare 4 Satisfactory - 30-39 FC and no glare 5 Very satisfactory - 40+ FC and no glare N/A Does not apply								1.00	3.00
5.3 Is there access to natural light in studios?					5		Comments	1.00	5.00
1 Very unsatisfactory - No learning spaces have natural light 2 Unsatisfactory - 1-25% of learning spaces have natural light or windows are too small to let in light 3 Average - 26-50% of learning spaces have natural light 4 Satisfactory - 51-75% of learning spaces have natural light 5 Very satisfactory - 76-100% of learning spaces have natural light N/A Does not apply									
5.4 Is there access to outside views from learning spaces?					5		Comments	1.00	5.00
1 Very unsatisfactory - No learning spaces have views 2 Unsatisfactory - 1-25% of learning spaces have views or windows are too small to see out 3 Average - 26-50% of learning spaces have views 4 Satisfactory - 51-75% of learning spaces have views 5 Very satisfactory - 76-100% of learning spaces have views					L			1.00	0.00
N/A Does not apply							· · · · · · · · · · · · · · · · · · ·		

5 - E	nvironmer	ntal Quality (cont.)	1	2	3	4	5	N/A			
5.5	Does the b	uilding have odor or pest problems?		2					Comments	1.00	2.00
	1	Very unsatisfactory - Evidence of both pests and odors							Odor problem in third gym. Main gym has minor smell	. The roof on the	-
	2	Unsatisfactory - Evidence of pests or odors							theater is problematic according to interview and they	have issues wit	h bats
	3	Average - Limited evidence of pests, no odors							in theater. Roof is currently under repair.		
	4	Satisfactory - No evidence of pests / odors, school cleanliness in good condition									
	5	Very Satisfactory - No evidence, school cleanliness in excellent condition									
	N/A	Does not apply									
6 - C	ontrollabi	lity of Systems	1	2	3	4	5	N/A	4	12.50	44%
6.1	Does the st	udio thermostat allow for individual control?	1						Comments	0.50	0.50
	1	No									
	5	Yes									
6.2	Are shades	provided to control natural light in learning spaces?				4			Comments	1.00	4.00
	1	Very unsatisfactory - No, windows are covered with boards/paper							Blinds average shape.		
	2	Unsatisfactory - No, windows have no light control									
	3	Average - Yes, but poor condition blinds									
	4	Satisfactory - Yes, blinds									
	5	Very satisfactory - Blackout shades									
	N/A	Does not apply									
6.3	What is the	quality of lighting controls in the studios?	1						Comments	1.00	1.00
	1	Very unsatisfactory - Single switch only per room							Single switch		
	2	Unsatisfactory - Alternating rows switch off									
	3	Average - Alternating lamps in single fixtures switch off									
	4	Satisfactory - Tri level switching									
	5	Very satisfactory - Dimmable									
	N/A	Does not apply									

7 - Furniture, F	ixtures & Equipment	1	2	3	4	5	N/A		18.75	64%
7.1 What is the	e current condition of the furniture?				4			Comments	0.75	3.00
1	Very unsatisfactory - Damaged or broken, non-functioning									
2	Unsatisfactory - Torn/ bent/ wrong size									
3	Average - Scratched/dented/marked									
4	Satisfactory - Not new, but sturdy and clean									
5	Very satisfactory - New									
N/A	Does not apply									
	sty of furniture types being accommodated throughout the arning commons, dining commons, other multi-use spaces?		2					Comments	1.00	2.00
1	Very Unsatisfactory - Same furniture used in all spaces							Library has different types of seating. Cafeteria only or	ne type of seatin	ng.
2	Unsatisfactory - Furniture variety in one multi-use space									
3	Average - Furniture variety in more than one multi-use space									
4	Satisfactory - All multi-use spaces have greater than one type of furniture									
5	Very satisfactory - All multi-use spaces have greater than two types of furniture									
N/A	Does not apply									
	loes furniture accommodate rapid reconfiguration of a			3				Comments		
space?			<u> </u>	Ľ	<u> </u>			Commonto	1.00	3.00
1	Very Unsatisfactory - Furniture is fixed or very heavy									
2	Unsatisfactory - Furniture does not allow desks to be configured as individuals, small groups, or large groups									
3	Average - Mix of furniture that can reconfigure but is cumbersome to move									
4	Satisfactory - Furniture is flexible for multiple configurations of space									
5	Very satisfactory - Furniture is flexible for multiple configurations of space, easy to move and stack									
N/A	Does not apply									
7.4 Is the furni	ture ergonomic and size appropriate for grade level?				4			Comments	1.00	4.00
1	Very unsatisfactory - Desk with attached chair combinations too small for grade level									
2	Unsatisfactory - Desk with attached chair combinations									
3	Average - Mix of studios with tables/loose chairs and desks with fixed seats									
4	Very satisfactory - Tables with loose chairs									
5	Very satisfactory - Tables with loose chairs that allow students to be active									
N/A	Does not apply									

02/11/2022 9

o Waste	1	2	3	4	5	N/A		5.00	70%
Do studios and corridors have blue recycle bins with bilingual instructions and/or image sorting instructions?			3				Comments	0.50	1.50
1 Very unsatisfactory - There are no recycling and landfill bins and signage are sparse or infrequent, OR there are only landfill bins with no recycling bins.		'		•		'	A score for this category is being recorded, but this cate in the overall ESA average.	gory is not cal	culated
2 Unsatisfactory - Bins and signage are sparse or infrequent and/or lack clear signage.									
3 Average - 50% of corridors and studios have both a landfill bin and a recycle bin in an accessible location. The containers have clear signage.									
4 Satisfactory - 75% of studios and corridors have a visible landfill and recycle collection containers in an accessible location. The containers have clear signage.									
Very satisfactory - All studios / corridors (100%) have visible landfill and recycle collection containers in accessible locations. The containers have clear signage, and the style and format is consistent and uniform across campus.									
N/A Does not apply									
Does the cafeteria (or wherever meals are served) have at least one of each: green compost bin, blue recycle bin, and landfill bin? Are the bins labelled clearly with bilingual and/or image sorting?				4			Comments	0.50	2.00
1 Very unsatisfactory- There may be landfill bins, but there are no compost and/or recycle bins. There is not clear sorting signage.		•		•	•	•			
2 Unsatisfactory- Recycle, landfill, and compost bins are present, but the bins are scattered and no co-located next to one another. Signage is absent or inconsistent.									
3 Average- There is at least one waste station with all three bins (recycle, compost, landfill) located with close proximity to one another. The signage is visible and consistent.									
4 Satisfactory- There are several waste stations as described above									
Very Satisfactory - There are several waste stations as described above, and additional signage in the cafeteria that encourages recycling/composting.									
N/A Does not apply									



School Name

4

N/A

Perkins&Will

Date:

Austin ISD Educational Suitability Assessment Criteria

Academics - Middle School / High School

or renovations to function well

condition

Does not apply

Satisfactory - Good size, connected, good condition Very Satisfactory - Generous size, connected, excellent

	Akins High	School							Carlos Cruz / Lynn Petermann	1/25/2021	
8 - <i>A</i>	Academics &	Learning	1	2	3	4	5	N/A		65.00	42%
8.1	Are studios o	appropriately configured per the ed spec?		2					Comments	1.00	2.00
	1	Very unsatisfactory - Too small, no flexibility, disconnected						•	Studios are undersized at 780 SF.		
	2	Unsatisfactory - Too small, only one area for all teaching methods, limited flexibility, disconnected									
	3	Neutral - Adequate size, multiple areas for different teaching methods, adequate flexibility, limited transparency and connection to other studios and shared learning spaces, needs updates or renovations to function well.									
	4	Satisfactory - Good size, multiple areas for different teaching methods, good flexibility, good transparency and connection to other studios and shared learning spaces									
	5	Very Satisfactory - Generous size, multiple areas for different teaching methods, excellent flexibility, generous display area and visual teaching tools, excellent transparency and connection with other studios and shared learning spaces									
	N/A	Does not apply									
8.2	Do studios h spec?	ave appropriate support spaces such as storage per the ed			3				Comments	1.00	3.00
	1 2	Very unsatisfactory - None provided Unsatisfactory - Too small, disconnected, poor condition									
	3	Neutral - Adequate size average condition needs undates									

Walk Attendees:

1 Very unsatisfactory - No breakout rooms or open collaboration spaces are provided 2 Unsatisfactory - Too small or too few, poor condition, no flexibility, lacks visual connection to learning neighborhood, poor acoustic privacy 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, and flexibility, transparency and connection to learning neighborhood, acoustic privacy 5 Very Satisfactory - Generous size, excellent condition and flexibility, transparency and connection to learning neighborhood, acoustic privacy N/A Does not apply 8.4 Are Science Labs and support spaces appropriately configured per the ed support space 3 Average - Adequate size, adequate science room 2 Unsatisfactory - No dedicated science room 3 Average - Adequate size, adequate condition, no connected support spaces 5 Very Satisfactory - Good size, good condition, no connected support spaces 5 Very Satisfactory - Generous size, excellent condition, connected support spaces 5 Very Satisfactory - Generous size, excellent condition, connected support spaces 6 Very Satisfactory - Generous size, excellent condition, connected support spaces 7 Very Moker Spaces and support spaces appropriately configured per the label of the space of th	8 - A	cademics 8	& Learning (cont.)	1	2	3	4	5	N/A	4	
collaboration spaces are provided 2 Unsatisfactory — Too small to too few, poor condition, no flexibility, locks visual connection to learning neighborhood, poor accounts privacy 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition and flexibility, transparency and connection to learning neighborhood, accountic privacy N/A Does not apply 8.4 Are Science Lots and support spaces appropriately configured per the ed support space: 1 Very unsatisfactory - No dedicated science room renovations or updates to function well 2 Unsatisfactory - Too small, poor condition, no connected support spaces 3 Average - Adequate size, adequate condition, connected support spaces 5 Very Satisfactory - Good size, good condition, connected support spaces 5 Very Satisfactory - Good size, excellent condition, connected from learning papees, not flexibility. 8.5 Are Maker Spaces and support spaces appropriately configured per the paper of the spaces of the space of t	8.3				2					Comments 1.00	2.00
flexibility, locks visual connection to learning neighborhood, poor acoustic privacy 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well renovations or updates to function well statisfactory - Good size, good condition and flexibility, transparency and connection to learning neighborhood, acoustic privacy N/A Does not apply 8.4 Are Science Labs and support spaces appropriately configured per the ed support spaces 1 Very unsatisfactory - No dedicated science room 2 Unsatisfactory - Too small, poor condition, needs some renovations or updates to function well 4 Satisfactory - Generous size, excellent condition, needs some renovations or updates to function well 5 Very Satisfactory - Generous size, excellent condition, connected support spaces 5 Very Satisfactory - Generous size, excellent condition, connected support spaces 5 Very Satisfactory - Generous size, excellent condition, connected support spaces 5 Very Satisfactory - Generous size, excellent condition, connected support spaces and support spaces an		1									and
renovations or updates to function well Satisfactory - Good size, good condition and flexibility, transparency and connection to learning neighborhood, accustic privacy N/A Does not apply 1 Very Satisfactory - To small, poor condition, connected support spaces 3 Average - Adequate size, adequate size, adequate condition, connected support spaces 5 Very Satisfactory - Generous size, excellent condition, connected from learning on support spaces appropriately configured per the ed 8.5 Are Moker's Green and support spaces appropriately configured per the ed 9 Satisfactory - Too small, poor condition, no connected support spaces 1 Very unsatisfactory - Too small, poor condition, needs some renovations or updates to function well 4 Satisfactory - Generous size, excellent condition, connected support spaces N/A Does not apply 1 Very Satisfactory - Too small, poor condition, acconnected from learning spaces on second floor that are advanced from learning spaces on flexibility 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well Satisfactory - Generous size, excellent condition, and support spaces on second floor that are advanced from learning spaces on second floor that are advanced from learning spaces and support spaces are novations or updates to function well No dedicated maker space. No dedicated maker space. No dedicated maker space.		2	flexibility, lacks visual connection to learning neighborhood,								
transparency and connection to learning neighborhood, acoustic privacy 5 Very Satisfactory - Generous size, excellent condition and flexibility, transparency and connection to learning neighborhood, acoustic privacy N/A Does not apply 8.4 Are Science Labs and support spaces appropriately configured per the ed spec? 1 Very unsatisfactory - No dedicated science room 2 Unsatisfactory - Too small, poor condition, no connected support space a personal sport space and support space and support space and sport space and support space and sport space and		3									
flexibility, transparency and connection to learning neighborhood, acoustic privacy N/A Does not apply 8.4 Are Science Labs and support spaces appropriately configured per the ed support space and support spaces appropriately configured per the ed spec? (cross reference with CTE below) 8.5 Are Maker Spaces and support spaces appropriately configured per the ed spec? (cross reference with CTE below) 1 Very unsatisfactory - No dedicated maker spaces 2 Unsatisfactory - Too small, poor condition, disconnected from learning spaces no flexibility 4 Satisfactory - Good size, accellent condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces 6 Very Satisfactory - Generous size, excellent condition, connected to learning spaces 7 Very Satisfactory - Generous size, excellent condition, connected to learning spaces 8 Very Satisfactory - Generous size, excellent condition, connected to learning spaces 9 Very Satisfactory - Generous size, excellent condition, connected to learning spaces 1 Very Satisfactory - Generous size, excellent condition, connected to learning spaces 1 Very Satisfactory - Generous size, excellent condition, connected to learning spaces		4	transparency and connection to learning neighborhood,								
8.4 Are Science Labs and support spaces appropriately configured per the ed spec? 1 Very unsatisfactory - No dedicated science room 2 Unsatisfactory - Too small, poor condition, no connected support space 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, connected support spaces 5 Very Satisfactory - Generous size, excellent condition, connected support spaces N/A Does not apply 8.5 Are Maker Spaces and support spaces appropriately configured per the ed spec? (cross reference with CTE below) 1 Very unsatisfactory - No dedicated maker spaces 2 Unsatisfactory - Too small, poor condition, disconnected from learning spaces, no flexibility 3 Average - Adequate size, adequate condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces		5	flexibility, transparency and connection to learning								
8.4 spec? 1 Very unsatisfactory - No dedicated science room 2 Unsatisfactory - Too small, poor condition, no connected support space 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, connected support spaces 5 Very Satisfactory - Generous size, excellent condition, connected support spaces N/A Does not apply 8.5 Are Maker Spaces and support spaces appropriately configured per the ed spec? (cross reference with CTE below) 1 Very unsatisfactory - No dedicated maker spaces 2 Unsatisfactory - No dedicated maker spaces 3 Average - Adequate size, adequate condition, inconnected from learning spaces, no flexibility 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, connected to learning spaces 5 Very Satisfactory - Good size, good condition, connected to learning spaces 6 Very Satisfactory - Good size, good condition, connected to learning spaces 7 Very Satisfactory - Good size, good condition, connected to learning spaces 8 Very Satisfactory - Good size, good condition, connected to learning spaces 9 Very Satisfactory - Good size, good condition, connected to learning spaces 9 Very Satisfactory - Good size, good condition, connected to learning spaces		N/A	Does not apply								
2 Unsatisfactory - Too small, poor condition, no connected support space 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, connected support spaces 5 Very Satisfactory - Generous size, excellent condition, connected support spaces N/A Does not apply 8.5 Are Maker Spaces and support spaces appropriately configured per the ed spec? (cross reference with CTE below) 1 Very unsatisfactory - Too small, poor condition, disconnected from learning spaces, no flexibility 3 Average - Adequate size, adequate condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces 6 Very Satisfactory - Generous size, excellent condition, connected to learning spaces	8.4		Labs and support spaces appropriately configured per the ed			3				Comments 1.00	3.00
support space 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, connected support spaces 5 Very Satisfactory - Generous size, excellent condition, connected support spaces N/A Does not apply 8.5 Are Maker Spaces and support spaces appropriately configured per the ed spec? (cross reference with CTE below) 1 Very unsatisfactory - No dedicated maker spaces 2 Unsatisfactory - Too small, poor condition, disconnected from learning spaces, no flexibility 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces		1	Very unsatisfactory - No dedicated science room		•					Adequate size but prep rooms used as storage in main building. New tech	
renovations or updates to function well 4 Satisfactory - Good size, good condition, connected support spaces 5 Very Satisfactory - Generous size, excellent condition, connected support spaces N/A Does not apply 8.5 Are Maker Spaces and support spaces appropriately configured per the ed spec? (cross reference with CTE below) 1 Very unsatisfactory - No dedicated maker spaces 2 Unsatisfactory - Too small, poor condition, disconnected from learning spaces, no flexibility 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces		2	· · · · · · · · · · · · · · · · · · ·							building has two science labs on second floor that are adequate.	
spaces Very Satisfactory - Generous size, excellent condition, connected support spaces N/A Does not apply Are Maker Spaces and support spaces appropriately configured per the ed spec? (cross reference with CTE below) 1 Very unsatisfactory - No dedicated maker spaces 2 Unsatisfactory - Too small, poor condition, disconnected from learning spaces, no flexibility 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces		3									
connected support spaces N/A Does not apply 8.5 Are Maker Spaces and support spaces appropriately configured per the ed spec? (cross reference with CTE below) 1 Very unsatisfactory - No dedicated maker spaces 2 Unsatisfactory - Too small, poor condition, disconnected from learning spaces, no flexibility 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces		4	•								
N/A Does not apply 8.5 Are Maker Spaces and support spaces appropriately configured per the ed spec? (cross reference with CTE below) 1 Very unsatisfactory - No dedicated maker spaces 2 Unsatisfactory - Too small, poor condition, disconnected from learning spaces, no flexibility 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces		5									
8.5 ed spec? (cross reference with CTE below) 1		N/A									
 Unsatisfactory - Too small, poor condition, disconnected from learning spaces, no flexibility Average - Adequate size, adequate condition, needs some renovations or updates to function well Satisfactory - Good size, good condition, connected to learning spaces Very Satisfactory - Generous size, excellent condition, connected to learning spaces 	8.5			1						Comments 1.00	1.00
from learning spaces, no flexibility 3 Average - Adequate size, adequate condition, needs some renovations or updates to function well 4 Satisfactory - Good size, good condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces		1	Very unsatisfactory - No dedicated maker spaces							No dedicated maker space.	
renovations or updates to function well 4 Satisfactory - Good size, good condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces		2									
4 Satisfactory - Good size, good condition, connected to learning spaces 5 Very Satisfactory - Generous size, excellent condition, connected to learning spaces		3									
Very Satisfactory - Generous size, excellent condition, connected to learning spaces		4	Satisfactory - Good size, good condition, connected to								
		5	Very Satisfactory - Generous size, excellent condition,								
		N/A	<u> </u>								

8 - A	cademics 8	Learning (cont.)	1	2	3	3 4	4_	5	N/A			
8.6	Is there a Pr	ofessional Learning Center in the learning neighborhood?	1							Comments	1.00	1.00
	1	Very unsatisfactory - No dedicated space for Professional Learning Center		•						None		
	2	Unsatisfactory - Too small, poor condition, disconnected										
	3	Average - Adequate size, adequate condition, needs some renovations or updates to function well										
	4	Satisfactory - Good size, good condition, connected										
	5	Very Satisfactory - Generous size, excellent condition, connected										
8.7		dequate places to display the evidence and artifacts of the 2D and 3D)?			3	3				Comments	1.00	3.00
	1	Very unsatisfactory - No dedicated space								Adequate display in fine arts building. Some display at 1	main entry in m	ain
	2	Unsatisfactory - Too small, non-dedicated, poor condition								building.		
	3	Average - Adequate size, adequate condition, needs updates or renovations to function well										
	4	Satisfactory - Good size, good condition										
	5	Very Satisfactory - Generous size, excellent condition										
	N/A	Does not apply	ı	1	_		_			T	1	
8.8		ilding / learning neighborhood provide adequate es for students/teachers to collaborate in varying group sizes?		2						Comments	1.00	2.00
	1	Very unsatisfactory - No space to support collaboration in various sizes.								Limited to no collaboration areas within the building. Or have the opportunity to provide additional collaboratio	•	
	2	Unsatisfactory - Too small, inflexible, only one option, does not support a variety of group sizes								space, though it's lacking proper outdoor furniture and	shade.	-
	3	Average - Adequate space for collaboration, needs updates or renovations to function well.										
	4	Satisfactory - Good size, good condition, multiple options to support a variety of group sizes										
	5	Very Satisfactory - Generous size, excellent condition, multiple options to support a variety of group sizes										
	N/A	Does not apply										
8.9	Does the bu	ilding provide opportunities for informal interaction?		2						Comments	1.00	2.00
	1	Very unsatisfactory - No space								Space in certain locations for informal interaction but fu	ırniture upgrad	es
	2	Unsatisfactory - Too small, poor condition, layout and furnishings do not support informal interaction well								required to function well.		
	3	Average - Adequate size and condition, needs updates or renovations to function well.										
	4	Satisfactory - Good size, good condition, layout and furnishings support informal interactions										
	5	Very Satisfactory - Generous size, excellent condition, layout and furnishings support informal interactions										
	N/A	Does not apply										

O2/11/2022 ⁴

8 - A	- Academics & Learning (cont.)			2	3	4	5	N/A			
8.10	Does the bui	lding provide adequate opportunities for students to work tly?	1						Comments	1.00	1.00
	1	Very unsatisfactory - No breakout rooms/small study spaces							No breakout spaces.		
	2	Unsatisfactory - Too small, poor condition, no acoustic privacy, only one space for independent work, disconnected from learning neighborhood									
	3	Average - Adequate size and condition, needs updates or renovations to function well.									
	4	Satisfactory - Good size and condition, acoustic privacy, variety of independent work space options, connected to learning neighborhood									
	5	Very Satisfactory - Generous size, excellent condition, acoustic privacy, variety of independent work space options, connected to learning neighborhood									
	N/A	Does not apply									
	Special Educ	cation									
8.11		Education spaces appropriately configured per the ed spec?			3				Comments	1.00	3.00
	1	Very unsatisfactory - Too small, no flexibility, disconnected							Five life skills units. Some have washer/dryer. Some do n	ot.	
	2	Unsatisfactory - Too small, only one area for all teaching methods, limited flexibility, disconnected									
	3	Neutral - Adequate size, multiple areas for different teaching methods, adequate flexibility, limited transparency and connection to other studios and shared learning spaces, needs updates or renovations to function well.									
	4	Satisfactory - Good size, multiple areas for different teaching methods, good flexibility, good transparency and connection to other studios and shared learning spaces									
	5	Very Satisfactory - Generous size, multiple areas for different teaching methods, excellent flexibility, generous display area and visual teaching tools, excellent transparency and connection with other studios and shared learning spaces									
	N/A	Does not apply									
8.12		Education support spaces, such as storage, space for er, appropriately configured per the ed spec?			3				Comments	1.00	3.00
	1	Very unsatisfactory - None provided									
	2	Unsatisfactory - Too small, disconnected, poor condition									
	3	Neutral - Adequate size, average condition, needs updates or renovations to function well									
	4	Satisfactory - Good size, connected, good condition									
	5	Very Satisfactory - Generous size, connected, excellent condition									
	N/A	Does not apply									

8 - Academics &	Academics & Learning (cont.)			3	4	5	N/A			
	ole restrooms and changing rooms readily available to the cation spaces?	1						Comments	1.00	1.00
1 5	No Yes							Not all life skills units have accessible restrooms.		
STEAM Cente										
8.14 Does the can	mpus have space to support a "STEAM" center?	1		T				Comments	0.00	0.00
1	Very unsatisfactory - No available space for STEAM center and inadequate studio / collaborative space							Monitoring answer, but does not count toward overall so	core.	
2	Unsatisfactory - Collaborative areas / studios for CTE/CCL are completely separate but adequate size									
3	Neutral - Collaborative areas / studios for CTE/CCL are adjacent but function separately									
4	Satisfactory - Collaborative areas / studios for CTE/CCL function and have space availability to create STEAM center									
5	Very Satisfactory - Functioning STEAM center offers studios, labs, common collaborative areas to support multimedia distance and hands-on project based learning									
N/A	Does not apply									
9 - CTE and Care	eer Connected Learning								15.00	80%
	your campus to a CTE cluster pathway that is aligned with ograms (Middle School only)?						N/A	Comments	0.00	0.00
1	Very unsatisfactory - No correlation to CTE cluster pathway, no CTE programs.									
2	Unsatisfactory - School supports less than half of the CTE programs that are listed in the cluster pathway.									
3	Average - School support half of CTE programs listed in the cluster pathway, but missing some.									
4	Satisfactory - School support a majority of CTE programs listed in the CTE cluster pathway.									
5	Very Satisfactory - School is aligned with CTE cluster									
N/A	pathway. Does not apply									
	facilities align with the CTE Ed Spec Requirements for the ways offered?: Architecture and Construction	1							0.05	0.05
1	No		_						0.25	0.25
5 N/A	Yes Does not apply									
•	and Video Technology and Communications					5				
									0.25	1.25
9.4 Business, Ma	anagement and Administration					5		Room 268	0.25	1.25
9.5 Education ar	nd Training	L				5		Cluster pathway	0.25	1.25
9.6 Health Science	ice	1						Taught in portable.	0.25	0.25

9 - CTE and Career Connected Learning (cont.)	1		2 3	4	5	N/A			
9.7 Hospitality and Tourism						N/A	No courses offered	0.00	0.00
9.8 Human Services (high school only)						N/A	No courses offered	0.00	0.00
9.9 Information Technology					5		In new tech academy. Not part of cluster pathway.	0.25	1.25
9.10 Agriculture, Food and Natural Resources	1						Ag barn / greenhouse require upgrades	0.25	0.25
9.11 Science, Technology, Engineering, and Mathematics					5		In Room 256.	0.25	1.25
9.12 Transportation, Distribution and Logistics						N/A	No courses offered	0.00	0.00
9.13 Finance (high school only)					5		Combined with business above	0.25	1.25
9.14 Government and Public Administration / JROTC Military programs (high school only)					5		Cluster pathway	0.25	1.25
9.15 Law, Public Safety, Corrections and Security (high school only)					5		ROTC downstairs. Room 268.	0.25	1.25
9.16 Manufacturing (high school only)						N/A	No courses offered	0.00	0.00
9.17 Marketing, Sales and Services (high school only)					5		Combined with business, finance	0.25	1.25
10 - Visual and Performing Arts								35.00	54%
10.1 Is there flexibility of space to also be used by CTE and Athletics?					5		Comments	0.00	0.00
1 No 5 Yes							Monitoring answer, but doesn't affect overall score.		
10.2 Are band and support spaces (rehearsal and storage) appropriately configured per the ed spec?			3				Comments	1.00	3.00
1 Very unsatisfactory - Too small, missing program spaces							Band hall 105. Percussion room is off of band hall. No red	al aux band hal	l.
 Unsatisfactory - Too small, poor condition Neutral - Adequate size, adequate condition, needs updates or renovations to function well. 									
4 Satisfactory - Good size, good condition									
5 Very Satisfactory - Generous size, excellent condition N/A Does not apply									
10.3 Are orchestra and support spaces appropriately configured per the ed spec?			3				Comments	1.00	3.00
Very unsatisfactory - Too small, missing program spaces		_			·		Orchestra and Guitar shard a room, Room 109, which is	labeled as Choi	
2 Unsatisfactory - Too small, poor condition							practice room uniform storage aux classroom where gui	tar is taught.	
 Neutral - Adequate size, adequate condition, needs updates or renovations to function well. 									
4 Satisfactory - Good size, good condition									
5 Very Satisfactory - Generous size, excellent condition N/A Does not apply									
1477. Does not apply									

Yes

11 - Athletics and Wellness						26.25	58%
11.1 Does the campus meet ed spec standard for physical education program spaces?		;	3		Comments	1.00	3.00
Very unsatisfactory - Too small, missing program spaces Unsatisfactory - Too small, poor condition Average - Adequate size, adequate condition, needs some renovations or updates to function well Satisfactory - Good size, good condition Very Satisfactory - Generous size, excellent condition N/A Does not apply					Good size weight room appears to be upgraded. Small g combined. PE lockers separate.	ym and large g	gym
11.2 Does the campus have a dedicated wellness center?	1				Comments	0.50	0.50
1 No 5 Yes							
11.3 Does the community have access to exterior playfields/courts?				5	Comments	0.50	2.50
1 No 5 Yes				_			
11.4 Are facilities available to facilitate eSports (High School only)?	1				Comments	0.00	0.00
1 No 5 Yes					Monitoring answer, but doesn't affect overall score.		
11.5 Are facilities set up to support UIL sanctioned athletics for basketball?	\perp			5	Comments	0.25	1.25
1 No 5 Yes							
11.6 Are facilities set up to support UIL sanctioned athletics for track?	1				Comments	0.25	0.25
1 No 5 Yes					6 lane track, no lighting.		
11.7 Are facilities set up to support UIL sanctioned athletics for football?	1				Comments	0.25	0.25
1 No 5 Yes					no seating, no lighting.		
11.8 Are facilities set up to support UIL sanctioned athletics for volleyball?				5	Comments	0.25	1.25
1 No 5 Yes		 					
11.9 Are facilities set up to support UIL sanctioned athletics for tennis?	1				Comments	0.25	0.25
1 No 5 Yes					courts not in good condition for matches		
11.10 Are facilities set up to support UIL sanctioned athletics for soccer?	1				Comments	0.25	0.25
1 No 5 Yes					field not adequate		

11 - Athletics and Wellness (cont.)	1	2	3	4	5	N/A		
11.11 Are facilities (dedicated storage) set up to support UIL sanctioned athletics for cross-country (high school only)?	1						Comments 0.25	0.25
1 No 5 Yes								
11.12 Are facilities (dedicated storage) set up to support UIL sanctioned athletics for golf (high school only)?	1						Comments 0.25	0.25
1 No 5 Yes								
11.13 Are facilities (dedicated storage) set up to support UIL sanctioned athletics for swimming (high school only)?	1						Comments 0.25	0.25
1 No 5 Yes								
11.14 Are facilities set up to support UIL sanctioned athletics for wrestling (high school only)?					5		Comments 0.25	1.25
1 No 5 Yes								
11.15 Are facilities set up to support UIL sanctioned athletics for baseball (high school only)?					5		Comments 0.25	1.25
1 No 5 Yes							Supports practice, and has small set of bleachers for spectator seating	
11.16 Are facilities set up to support UIL sanctioned athletics for softball (high school only)?					5		Comments 0.25	1.25
1 No 5 Yes	•	•				•	Supports practice, and has small set of bleachers for spectator seating	
11.17 Are facilities (dedicated space outside of the gymnasium) available to support competitive spirit activities for cheerleading and drill team?					5		Comments 0.25	1.25
1 No 5 Yes							Third gym has mats for cheer.	
11 - Athletics and Wellness (cont.)	1	2	3	4	5	N/A		
How do the athletics fields align with FMP Campus Improvements? Turf Field, Parking lot lighting, ADA accessible amenities (high School only)	1						Comments 0.00	0.00
1 Very unsatisfactory - No turf, inaccessible, no site lighting							Monitoring answer, but doesn't affect overall score.	
2 Unsatisfactory - No turf/field in poor condition, some accessibility concerns, poor site lighting								
Average - Field in adequate condition, needs some updates or renovations to function well								
4 Satisfactory - Turf field in good condition, good ADA access and site lighting								
5 Very Satisfactory - Turf field with excellent maintenance, excellent ADA access for spectators and athletes, excellent site lighting								
N/A Does not apply.								

02/11/2022 ¹⁰

12 -	Food Service	es								10.00	40%
12.1	l Is the Dining	Commons appropriately configured per the ed spec?		2					Comments	1.00	2.00
	1 2 3 4 5	Very unsatisfactory - Too small, missing program spaces Unsatisfactory - Too small, poor condition, only one option for eating space provided, inadequate circulation Average - Adequate size and condition, needs updates or renovations to function well Satisfactory - Good size and condition, good circulation, multiple options for eating space (ex: connection to outdoor eating space) Very Satisfactory - Generous size, excellent condition and circulation, multiple options for eating space (ex: connection to outdoor eating space)							Too small for current student enrollment. Current size ~1 16,000 SF for 2,800 students. Connected to small outdo		d be
_	N/A	Does not apply	ı	1	_		_	_			
12.2	spec?	d Services support spaces appropriately configured per the ed		2					Comments	1.00	2.00
	1 2 3 4 5	Very unsatisfactory - None provided Unsatisfactory - Too small, disconnected, poor condition Neutral - Adequate size, average condition, needs updates or renovations to function well Satisfactory - Good size, connected, good condition Very Satisfactory - Generous size, connected, excellent condition							Kitchen is undersized. No storage within cafeteria build	ing.	
	N/A	Does not apply									
13 -	Media Reso		1	2	. 3	3 4	5	N/	/A	30.00	57%
13.1	l Is the Library to the schoo				3	3			Comments	1.00	3.00
	1 2 3 4 5	Very unsatisfactory - Not accessible Unsatisfactory - Limited access, difficult to find, no transparency Average - Adequate accessibility, needs updates or renovations to function well Satisfactory - Accessible, easy to find, good transparency, good condition Very Satisfactory - Accessible, easy to find, excellent transparency, excellent condition							Library at main entry but open to rest of school.		

13 - Media Res	3 - Media Resources - Continued			3	4	5	N/A	4		
13.2 How well o	does the Library/Media Center support quiet study?		2					Comments	1.00	2.00
1 2 3 4 5	Very unsatisfactory - No quiet study spaces Unsatisfactory - One area in poor condition, poor acoustic privacy Average - One or more areas provided, needing updates or renovations to function well Satisfactory - Clusters or small rooms adjacent to media center, good condition, good acoustic privacy Very Satisfactory - Multiple clusters or small rooms adjacent to media center, excellent condition, excellent acoustic privacy						•	One large open space. No breakout spaces for quiet stud	<i>y</i> .	
N/A	Does not apply		l	Г	Т	Τ	Т			
13.3 How well o	does the Library/Media Center support social interaction?			3				Comments	1.00	3.00
1 2 3	Very unsatisfactory - No space Unsatisfactory - Too small, poor condition, layout and furnishings do not support informal interaction well Average - Adequate size and condition, needs updates or renovations to function well.									
4	Satisfactory - Good size, good condition, layout and furnishings support informal interactions									
5	Very Satisfactory - Generous size, excellent condition, layout and furnishings support informal interactions									
N/A	Does not apply does the Library/Media Center support collaborative work in	_	Т	Г	Τ	Τ	Г			
	ps (4-8 students)?			3				Comments	1.00	3.00
1	Very unsatisfactory - No breakout rooms, no flexible furniture, no support							Set up for smaller groups in separate locations.		
2	Unsatisfactory - Too small, one area, poor condition									
3	Average - Adequate size, multiple areas provided, needing updates or renovations to function well									
4	Satisfactory - Clusters or small rooms adjacent to media center, flexible furniture, good condition									
5	Very Satisfactory - Multiple clusters or small rooms adjacent to media center, flexible furniture, excellent condition									
N/A	Does not apply									
	does the Library/Media Center support collaborative work in ups (10-25)?			3				Comments	1.00	3.00
1	Very unsatisfactory - No gathering areas							One large space. Set up to accommodate different group	sizes. Furnitur	e in
2	Unsatisfactory - Too small, one common space, limited seating, poor condition							okay condition. Bulky to move.		
3	Average - Adequate size, one common space, needs updates or renovations to function well									
4	Satisfactory - Good size, multiple common spaces with seating, good condition									
5	Very Satisfactory - Generous size, multiple commons spaces with seating, excellent condition									
N/A	Does not apply									

3 - Media Resources - Continued			2	3	4	5	N/A			
13.6 How well do	es the Library/Media Center support technology?			3				Comments	1.00	3.00
1 2	Very unsatisfactory - No vis comm tools Unsatisfactory - Outdated, poorly functioning, or insufficient							Charging towers and computer lab set up. A few edu-disple computer lab in room off to side of library.	lays. Separate	e
3	Average - Mix of old and new whiteboards/projectors/etc.									
4	Satisfactory - projectors, marker boards, smart boards in most spaces - good condition									
5	Very Satisfactory - projectors, marker boards, smart boards in most spaces - new condition									
N/A	Does not apply									
14 - Technology		1	2	3	4	5	N/A		20.00	55%
14.1 How well eq	uipped are the facilities with instructional technology?			3				Comments	1.00	3.00
1	Very unsatisfactory - Limited to no technology present in					•		Edu-display and chalkboards; no white boards.		
2	instructional spaces Unsatisfactory - One type of technology present									
3	Average - Multiple types of technology, smart boards. Poor									
3	condition. Limited to only certain areas of school.									
4	Satisfactory - Multiple types of technology, smart boards. Good condition.									
5	Very Satisfactory - Multiple types of technology, smart boards. Excellent condition									
N/A	Does not apply									
spaces?	dequate number of power and data outlets in learning			3				Comments	1.00	3.00
1	Very unsatisfactory - Outlet configuration does not support digital devices throughout school (1 per wall)									
2	Unsatisfactory - Outlet configuration support digital devices only in certain areas of school (2 per wall)									
3	Average - Outlet configuration support digital devices but limited capacity throughout school (3 per wall)									
4	Satisfactory - Outlet configuration support digital devices with adequate coverage and capacity in limited locations (>3 per wall)									
5	Very Satisfactory - Excellent outlet configuration to support digital devices throughout school (>3 per wall)									
N/A	Does not apply									

O2/11/2022 ¹³

14 - Technol	ogy (cont.)	1	2	3	4	5	N/A	A		
14.3 Are the	re adequate charging locations for devices?			3				Comments	1.00	3.00
1	Very unsatisfactory - Not enough charging locations throughout school for 1:1									
2	Unsatisfactory - Charging locations, haphazard locations, and inadequate in size for number of devices									
3	Average - Charging locations well organized but not enough capacity for 1:1									
4	Satisfactory - Charging locations, haphazard locations, but supports 1:1.									
5	Very Satisfactory - Charging locations throughout school to support 1:1.									
N//	A Does not apply									
14.4 Is there	adequate AV for presentations spaces – cafeteria, gym, aux gym? $ \\$		2					Comments	1.00	2.00
1	Very unsatisfactory - AV not present in one or more space									
2	Unsatisfactory - AV undersized for room. Poor condition									
3	Average - AV adequately sized / poor condition OR AV undersized / average condition									
4	Satisfactory - AV adequately sized for room. Average Condition.									
5	Very Satisfactory - AV adequately sized for room. Excellent condition.									
N//	A Does not apply									
14.5 Is there	digital media signage at the reception area?	1						Comments	0.00	0.00
1	Very unsatisfactory - No digital media present in reception area									
2	* * * * * * * * * * * * * * * * * * * *									
3	Average - Adequately sized / poor condition OR undersized / adequate condition									
4	Satisfactory - Media signage present, good sized, good condition									
5	Very Satisfactory - Generously sized, excellent condition									
N/A	A Does not apply									

15	- Administra	tion Spaces	1	2	3	4	5	N/A		20.00	60%
I	5.1 Is there a re visitors?	ception area that functions as a security checkpoint for all							Comments	1.00	
	1	Very unsatisfactory - No security checkpoint									
	2	Unsatisfactory - Checkpoint is too small, poor condition									
	3	Average - Needs updates or renovations to function well									
	4	Satisfactory - Good size, good condition									
	5	Very Satisfactory - Generous size, excellent condition									
_	N/A	Does not apply				Г			,		
1	5.2 Does the ac	lministration area feel welcoming?			3				Comments	1.00	3.00
	1	Very unsatisfactory - No welcome space									
	2	Unsatisfactory - Too small, poor lighting and transparency, limited informal seating, poor condition									
	3	Average - Adequate size and layout, needs updates or renovations to feel welcoming									
	4	Satisfactory - Good size and layout, good lighting and transparency, informal seating provided									
	5	Very Satisfactory - Generous size and layout, plenty of light and transparency, informal seating provided, excellent condition									
	N/A	Does not apply									
1:		aces that require it, does the administration area have coustic privacy?				4			Comments	1.00	4.00
	1	Very unsatisfactory - No acoustic separations							Audible talking but could not discern words.		
	2	Unsatisfactory - Acoustic separations do not perform well									
	3	Average - Some acoustic separations function okay, but portions need updates or renovations									
	4	Satisfactory - Good acoustic separations									
	5	Very Satisfactory - Excellent acoustic separations									
	N/A	Does not apply									
15	5.4 Are confere	nce rooms easily accessed for public / parent use?			3				Comments	1.00	3.00
	1	Very unsatisfactory - Not accessible for public/parent use							Conference room only in principal's office.		
	2	Unsatisfactory - Limited access, no transparency, poor condition, difficult to find									
	3	Average - Adequate accessibility, needs updates or renovations to function well									
	4	Satisfactory - Good accessibility, good transparency, good size and condition									
	5	Very Satisfactory - Excellent accessibility, excellent transparency, generous size, excellent condition									
	N/A	Does not apply									